


# Upínač Weldon pro upínací stopky


## Upínač Weldon DIN 6359 pro upínací stopky DIN 1835-B

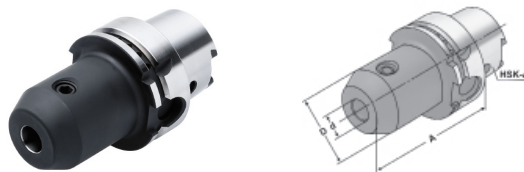

| Název            | Kužel  | D  | d  | A   | G 2,5<br>25.000 min <sup>-1</sup> |
|------------------|--------|----|----|-----|-----------------------------------|
| HSK63A.65.WE.06  | HSK63A | 25 | 6  | 65  | •                                 |
| HSK63A.65.WE.08  | HSK63A | 28 | 8  | 65  | •                                 |
| HSK63A.65.WE.10  | HSK63A | 35 | 10 | 65  | •                                 |
| HSK63A.80.WE.12  | HSK63A | 42 | 12 | 80  | •                                 |
| HSK63A.80.WE.14  | HSK63A | 44 | 14 | 80  | •                                 |
| HSK63A.80.WE.16  | HSK63A | 48 | 16 | 80  | •                                 |
| HSK63A.80.WE.18  | HSK63A | 50 | 18 | 80  | •                                 |
| HSK63A.80.WE.20  | HSK63A | 52 | 20 | 80  | •                                 |
| HSK63A.110.WE.25 | HSK63A | 65 | 25 | 110 | •                                 |
| HSK63A.110.WE.32 | HSK63A | 72 | 32 | 110 | •                                 |
| HSK63A.125.WE.40 | HSK63A | 80 | 40 | 125 | •                                 |
| HSK63A.100.WE.06 | HSK63A | 25 | 6  | 100 | •                                 |
| HSK63A.100.WE.08 | HSK63A | 28 | 8  | 100 | •                                 |
| HSK63A.100.WE.10 | HSK63A | 35 | 10 | 100 | •                                 |
| HSK63A.100.WE.12 | HSK63A | 35 | 12 | 100 | •                                 |
| HSK63A.100.WE.14 | HSK63A | 44 | 14 | 100 | •                                 |
| HSK63A.100.WE.16 | HSK63A | 48 | 16 | 100 | •                                 |
| HSK63A.100.WE.18 | HSK63A | 50 | 18 | 100 | •                                 |
| HSK63A.100.WE.20 | HSK63A | 52 | 20 | 100 | •                                 |
| HSK63A.130.WE.06 | HSK63A | 25 | 6  | 130 | •                                 |
| HSK63A.130.WE.08 | HSK63A | 28 | 8  | 130 | •                                 |
| HSK63A.130.WE.10 | HSK63A | 35 | 10 | 130 | •                                 |
| HSK63A.130.WE.12 | HSK63A | 35 | 12 | 130 | •                                 |
| HSK63A.130.WE.14 | HSK63A | 44 | 14 | 130 | •                                 |
| HSK63A.130.WE.16 | HSK63A | 48 | 16 | 130 | •                                 |
| HSK63A.130.WE.18 | HSK63A | 50 | 18 | 130 | •                                 |
| HSK63A.130.WE.20 | HSK63A | 52 | 20 | 130 | •                                 |
| HSK63A.160.WE.06 | HSK63A | 25 | 6  | 160 | •                                 |
| HSK63A.160.WE.08 | HSK63A | 28 | 8  | 160 | •                                 |
| HSK63A.160.WE.10 | HSK63A | 35 | 10 | 160 | •                                 |
| HSK63A.160.WE.12 | HSK63A | 35 | 12 | 160 | •                                 |
| HSK63A.160.WE.14 | HSK63A | 44 | 14 | 160 | •                                 |
| HSK63A.160.WE.16 | HSK63A | 48 | 16 | 160 | •                                 |
| HSK63A.160.WE.18 | HSK63A | 50 | 18 | 160 | •                                 |
| HSK63A.160.WE.20 | HSK63A | 52 | 20 | 160 | •                                 |

# Upínač Weldon pro upínací stopky

## Upínač Weldon DIN 6359 pro upínací stopky DIN 1835-B

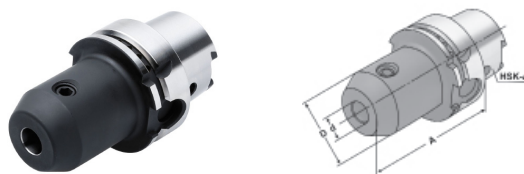

| Název             | Kužel   | D  | d  | A   | G 2,5<br>25.000 min <sup>-1</sup> |
|-------------------|---------|----|----|-----|-----------------------------------|
| HSK100A.80.WE.06  | HSK100A | 25 | 6  | 80  | •                                 |
| HSK100A.80.WE.08  | HSK100A | 28 | 8  | 80  | •                                 |
| HSK100A.80.WE.10  | HSK100A | 35 | 10 | 80  | •                                 |
| HSK100A.80.WE.12  | HSK100A | 42 | 12 | 80  | •                                 |
| HSK100A.80.WE.14  | HSK100A | 44 | 14 | 80  | •                                 |
| HSK100A.100.WE.16 | HSK100A | 48 | 16 | 100 | •                                 |
| HSK100A.100.WE.18 | HSK100A | 50 | 18 | 100 | •                                 |
| HSK100A.100.WE.20 | HSK100A | 52 | 20 | 100 | •                                 |
| HSK100A.100.WE.25 | HSK100A | 65 | 25 | 100 | •                                 |
| HSK100A.100.WE.32 | HSK100A | 72 | 32 | 100 | •                                 |
| HSK100A.105.WE.40 | HSK100A | 80 | 40 | 105 | •                                 |
| HSK100A.160.WE.06 | HSK100A | 25 | 6  | 160 | •                                 |
| HSK100A.160.WE.08 | HSK100A | 28 | 8  | 160 | •                                 |
| HSK100A.160.WE.10 | HSK100A | 35 | 10 | 160 | •                                 |
| HSK100A.160.WE.12 | HSK100A | 35 | 12 | 160 | •                                 |
| HSK100A.160.WE.14 | HSK100A | 44 | 14 | 160 | •                                 |
| HSK100A.160.WE.16 | HSK100A | 48 | 16 | 160 | •                                 |
| HSK100A.160.WE.18 | HSK100A | 50 | 18 | 160 | •                                 |
| HSK100A.160.WE.20 | HSK100A | 52 | 20 | 160 | •                                 |
| HSK100A.160.WE.25 | HSK100A | 65 | 25 | 160 | •                                 |
| HSK100A.160.WE.32 | HSK100A | 72 | 32 | 160 | •                                 |
| HSK100A.160.WE.40 | HSK100A | 80 | 40 | 160 | •                                 |